




TYPICAL SECTION AT REMOVED EXISTING WALL
3/4" = 1'-0"

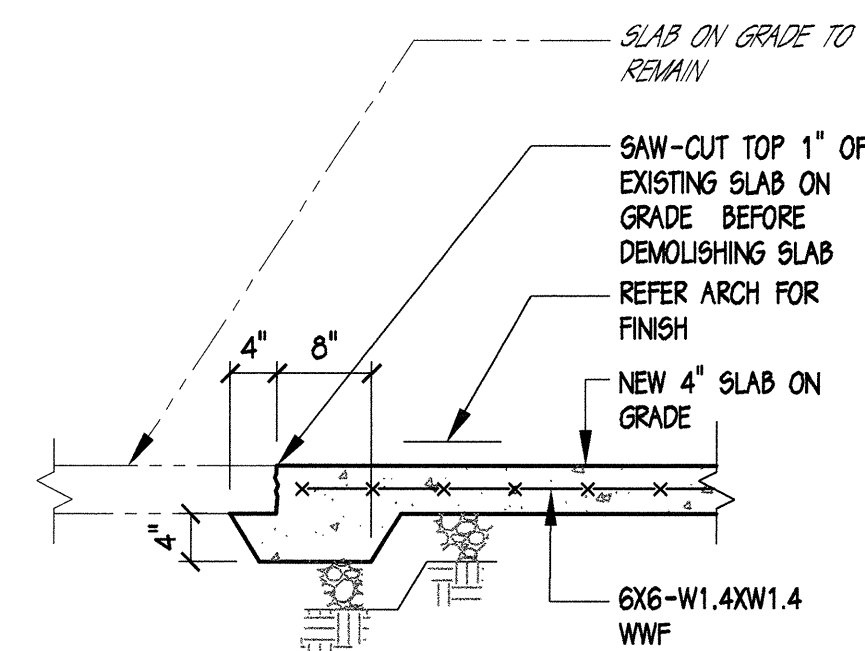


TYPICAL SLAB ON GRADE REPAIR DETAIL

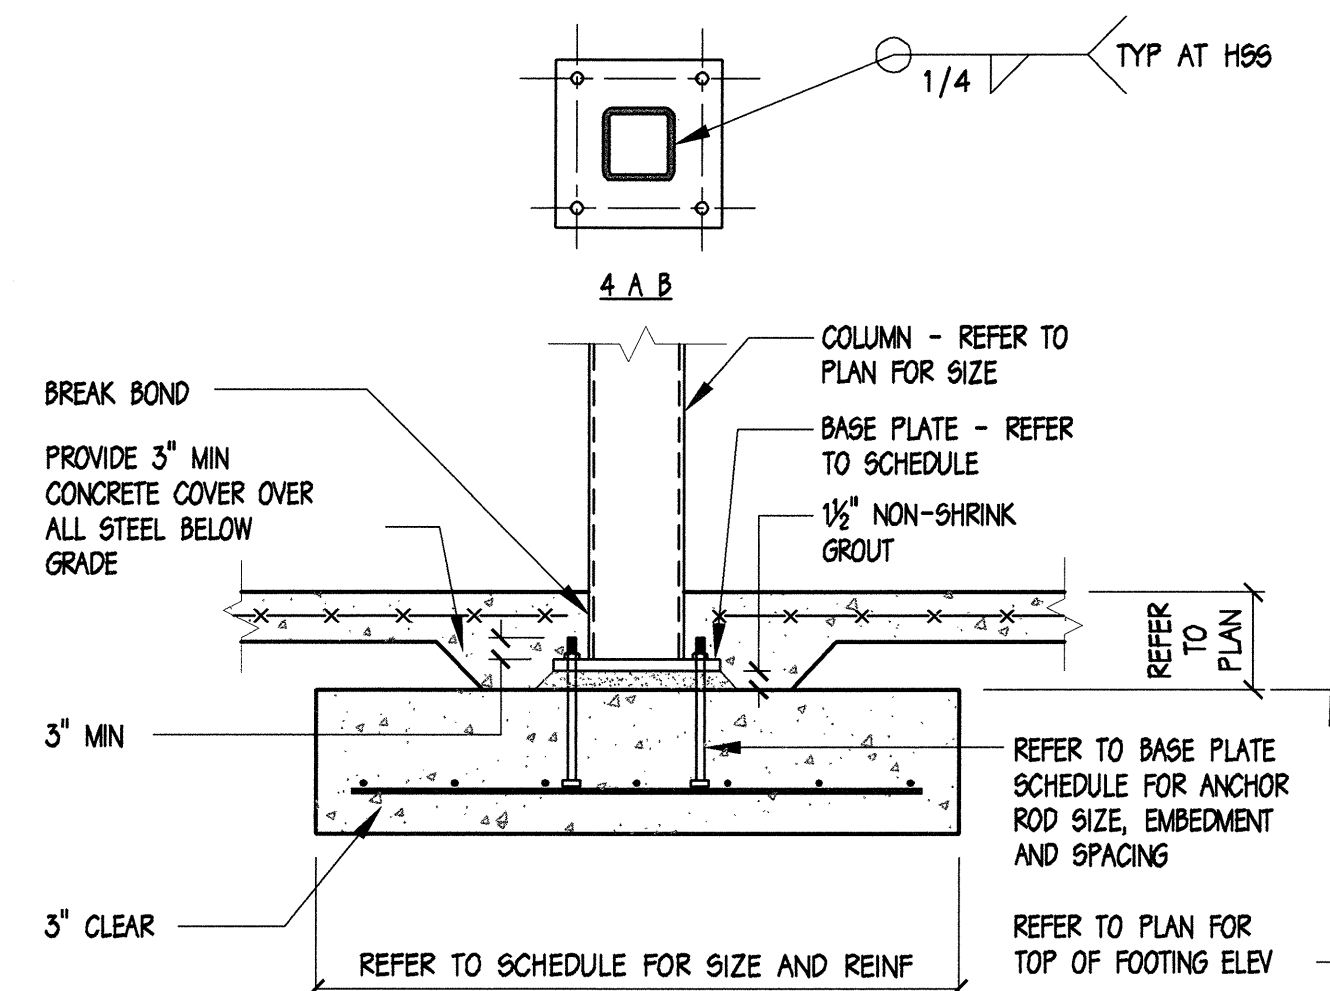

TYPICAL COLUMN FOOTING
3/4" = 1'-0"

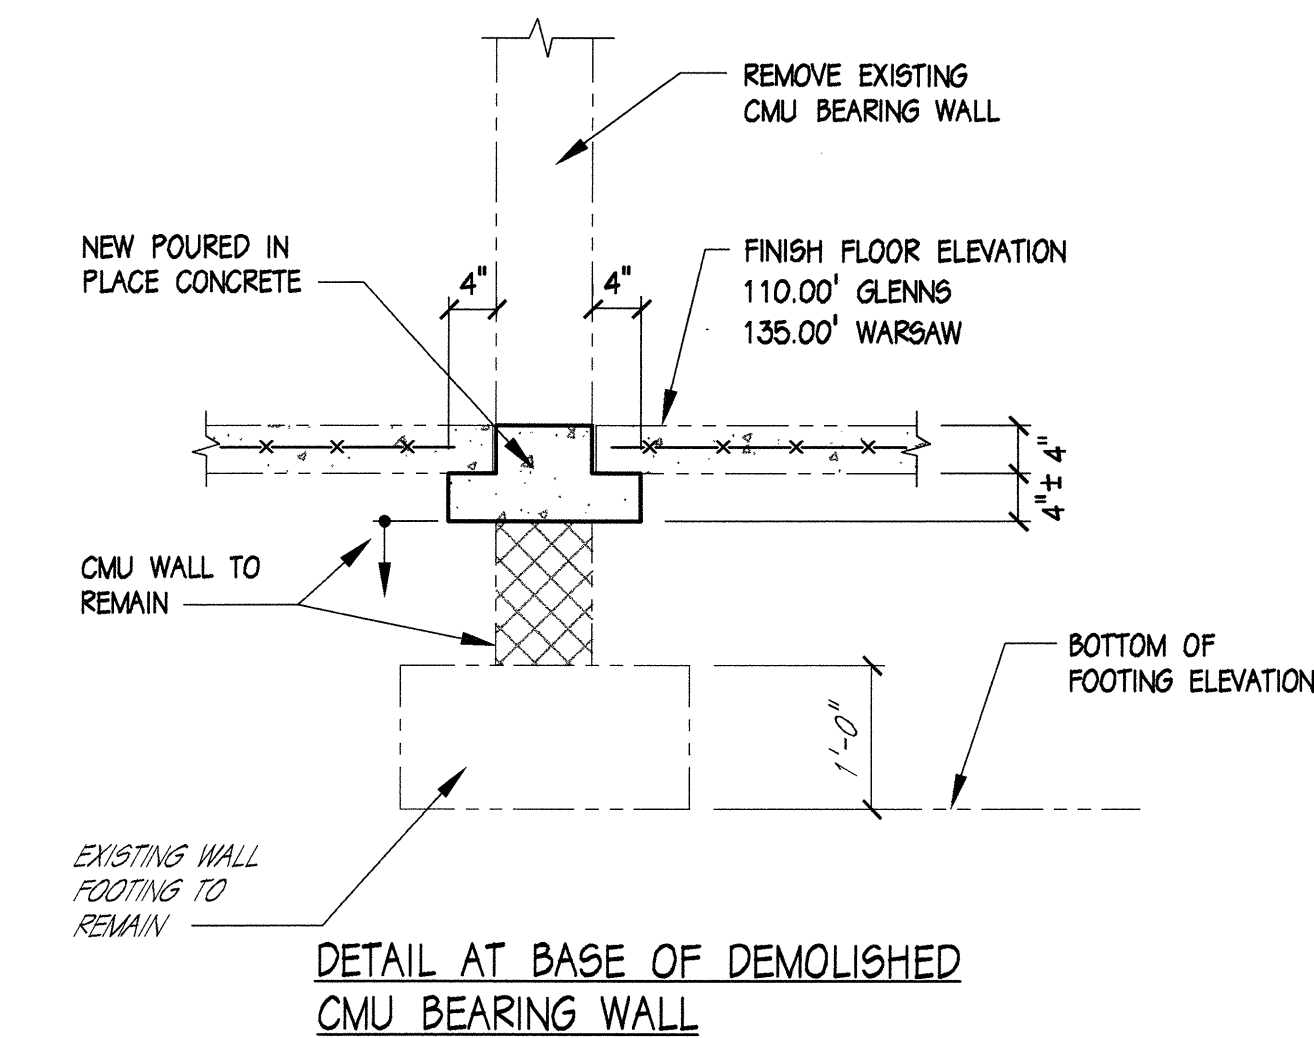


SECTION 1
3/4" = 1'-0"

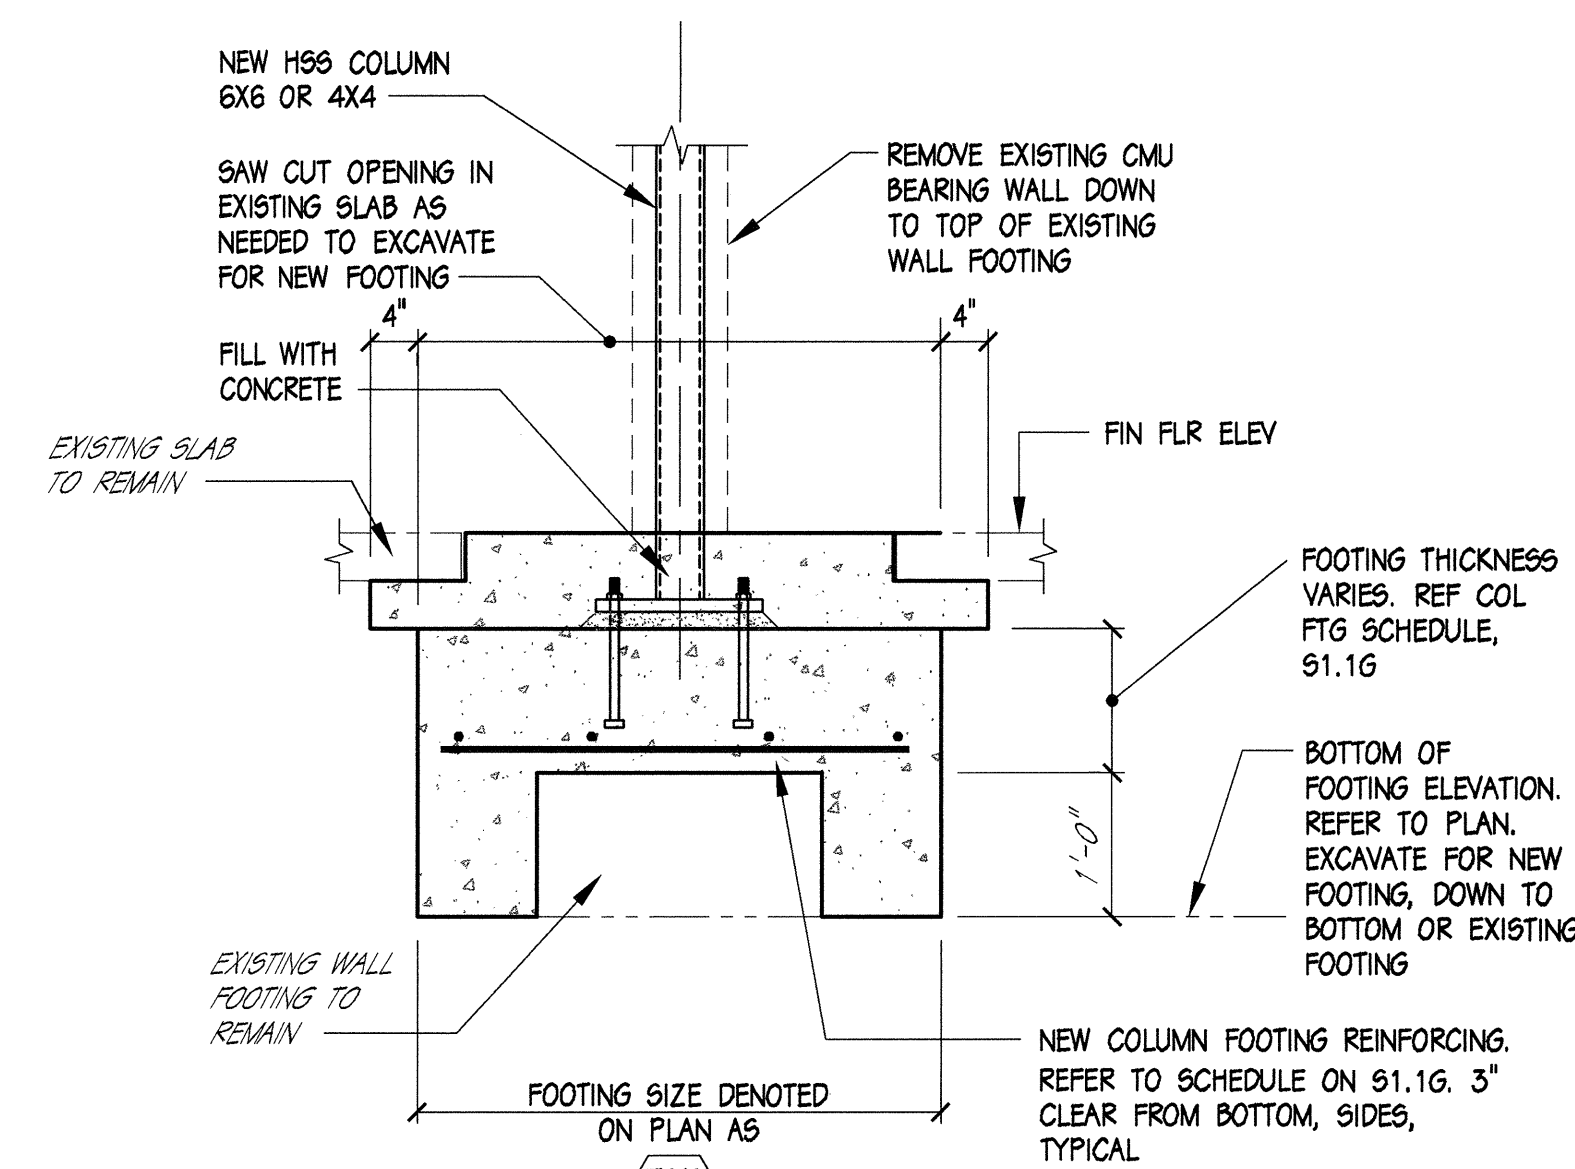


TYPICAL AT ALL NEW COLUMN FOOTINGS WITHOUT A PIER UNLESS NOTED OTHERWISE

SECTION 2
3/4" = 1'-0"

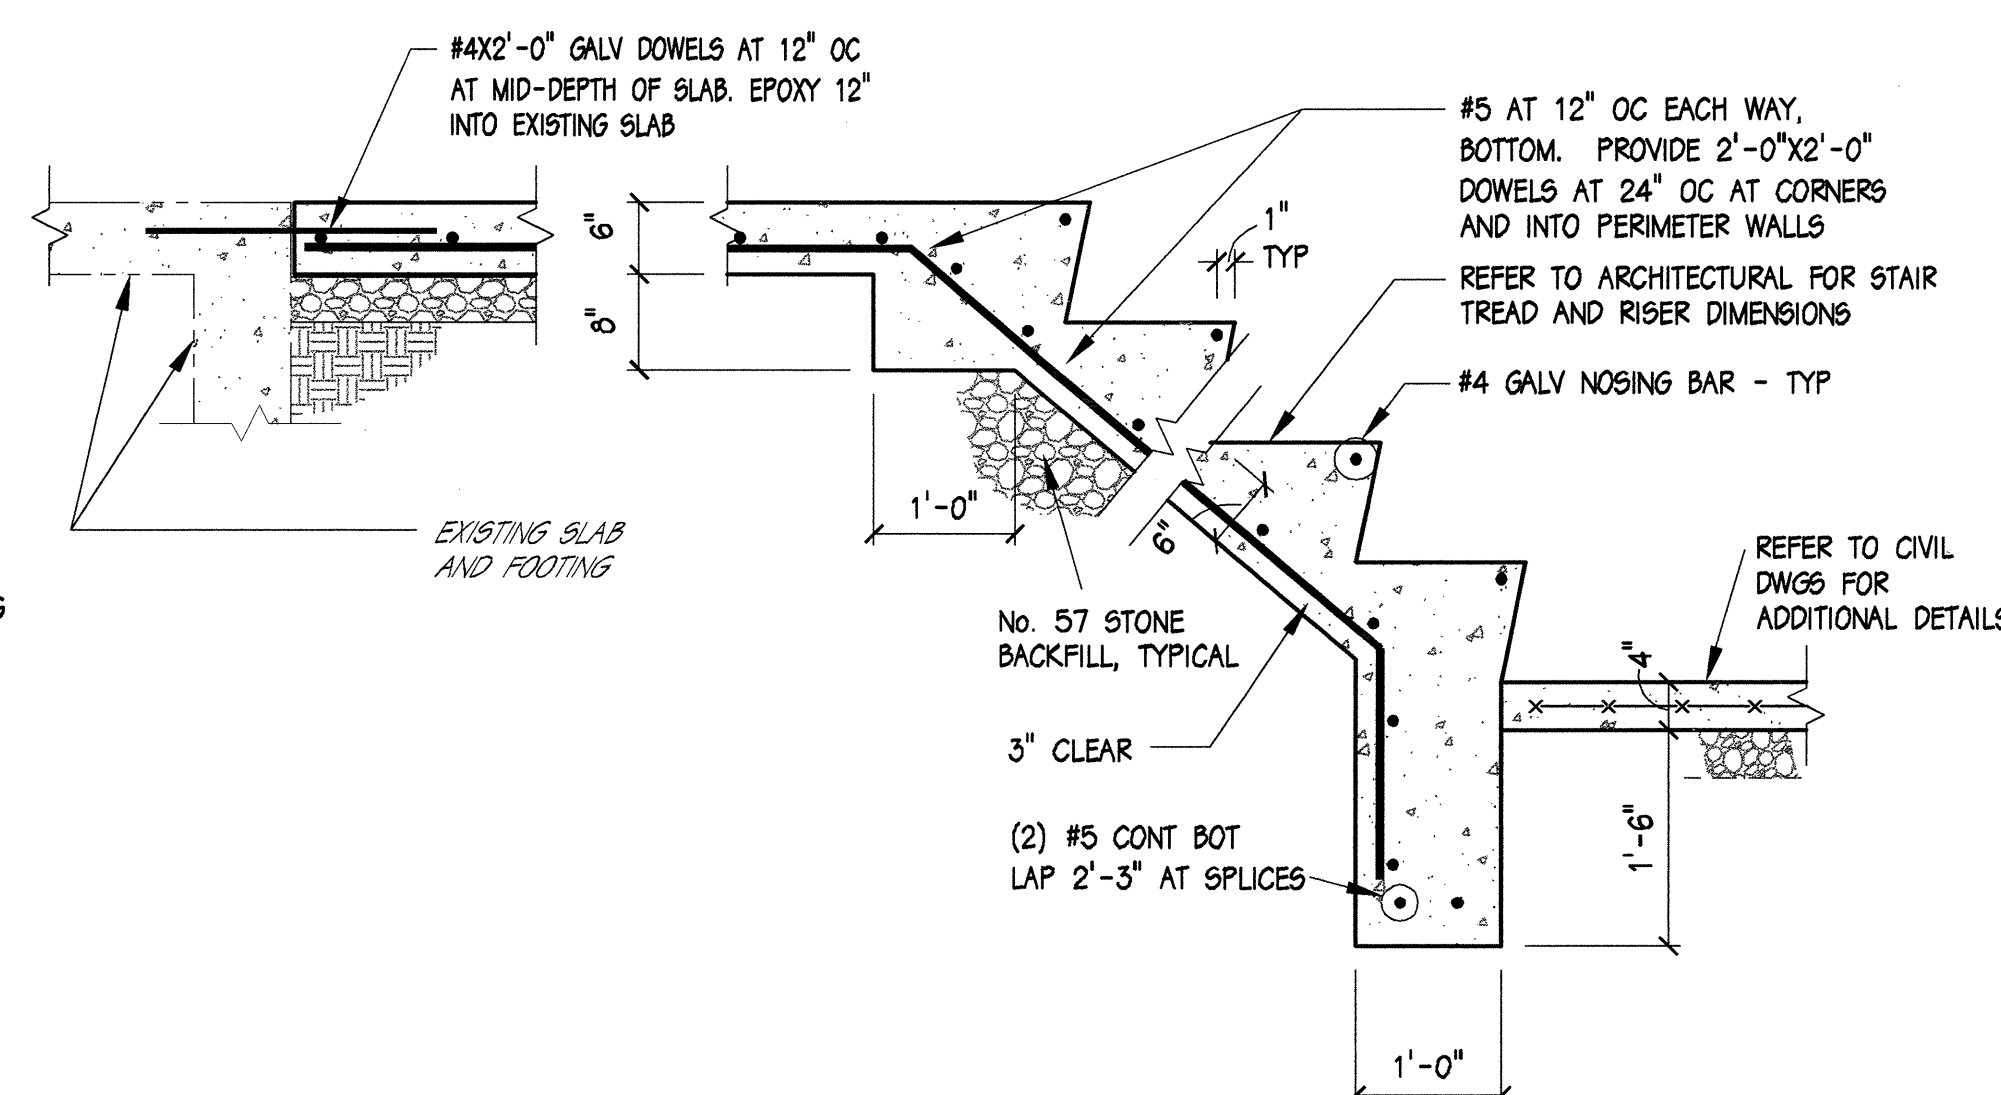


SECTION 3
3/4" = 1'-0"

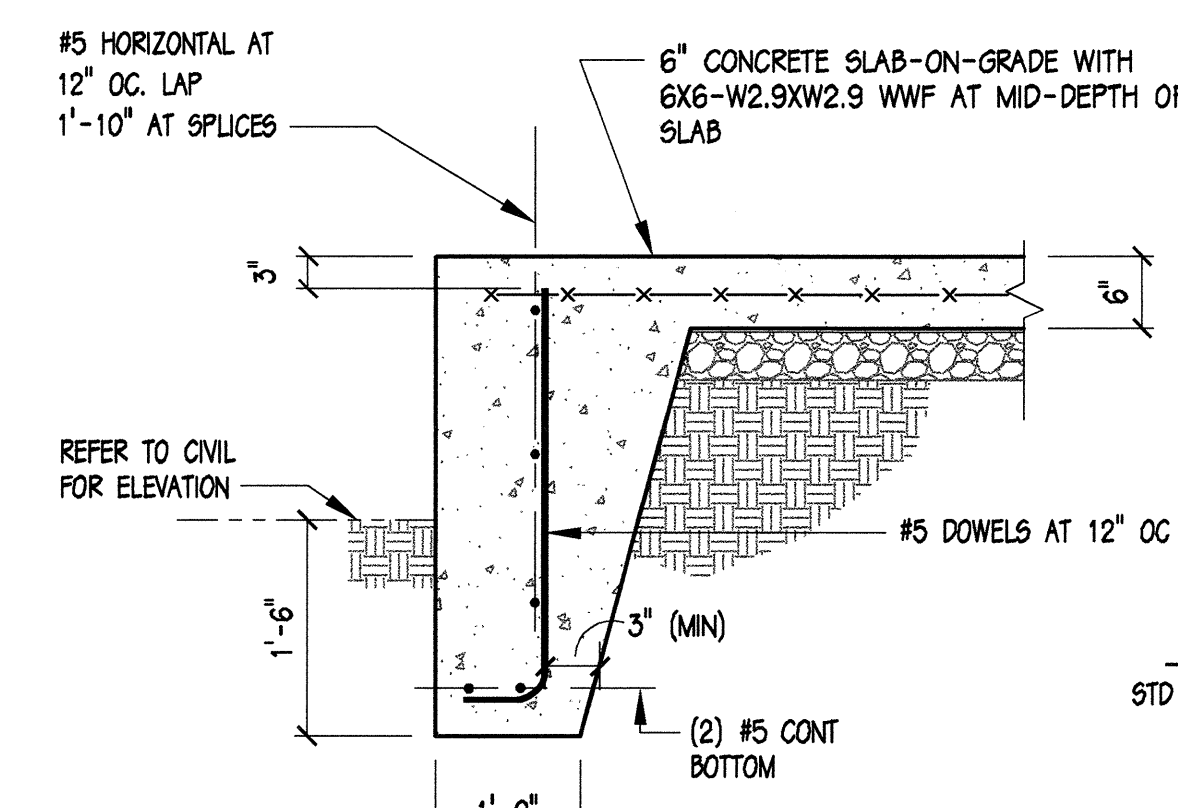

TYPICAL AT PERIMETER OF HANDICAP RAMP ALL SIDES

SECTION 4
3/4" = 1'-0"

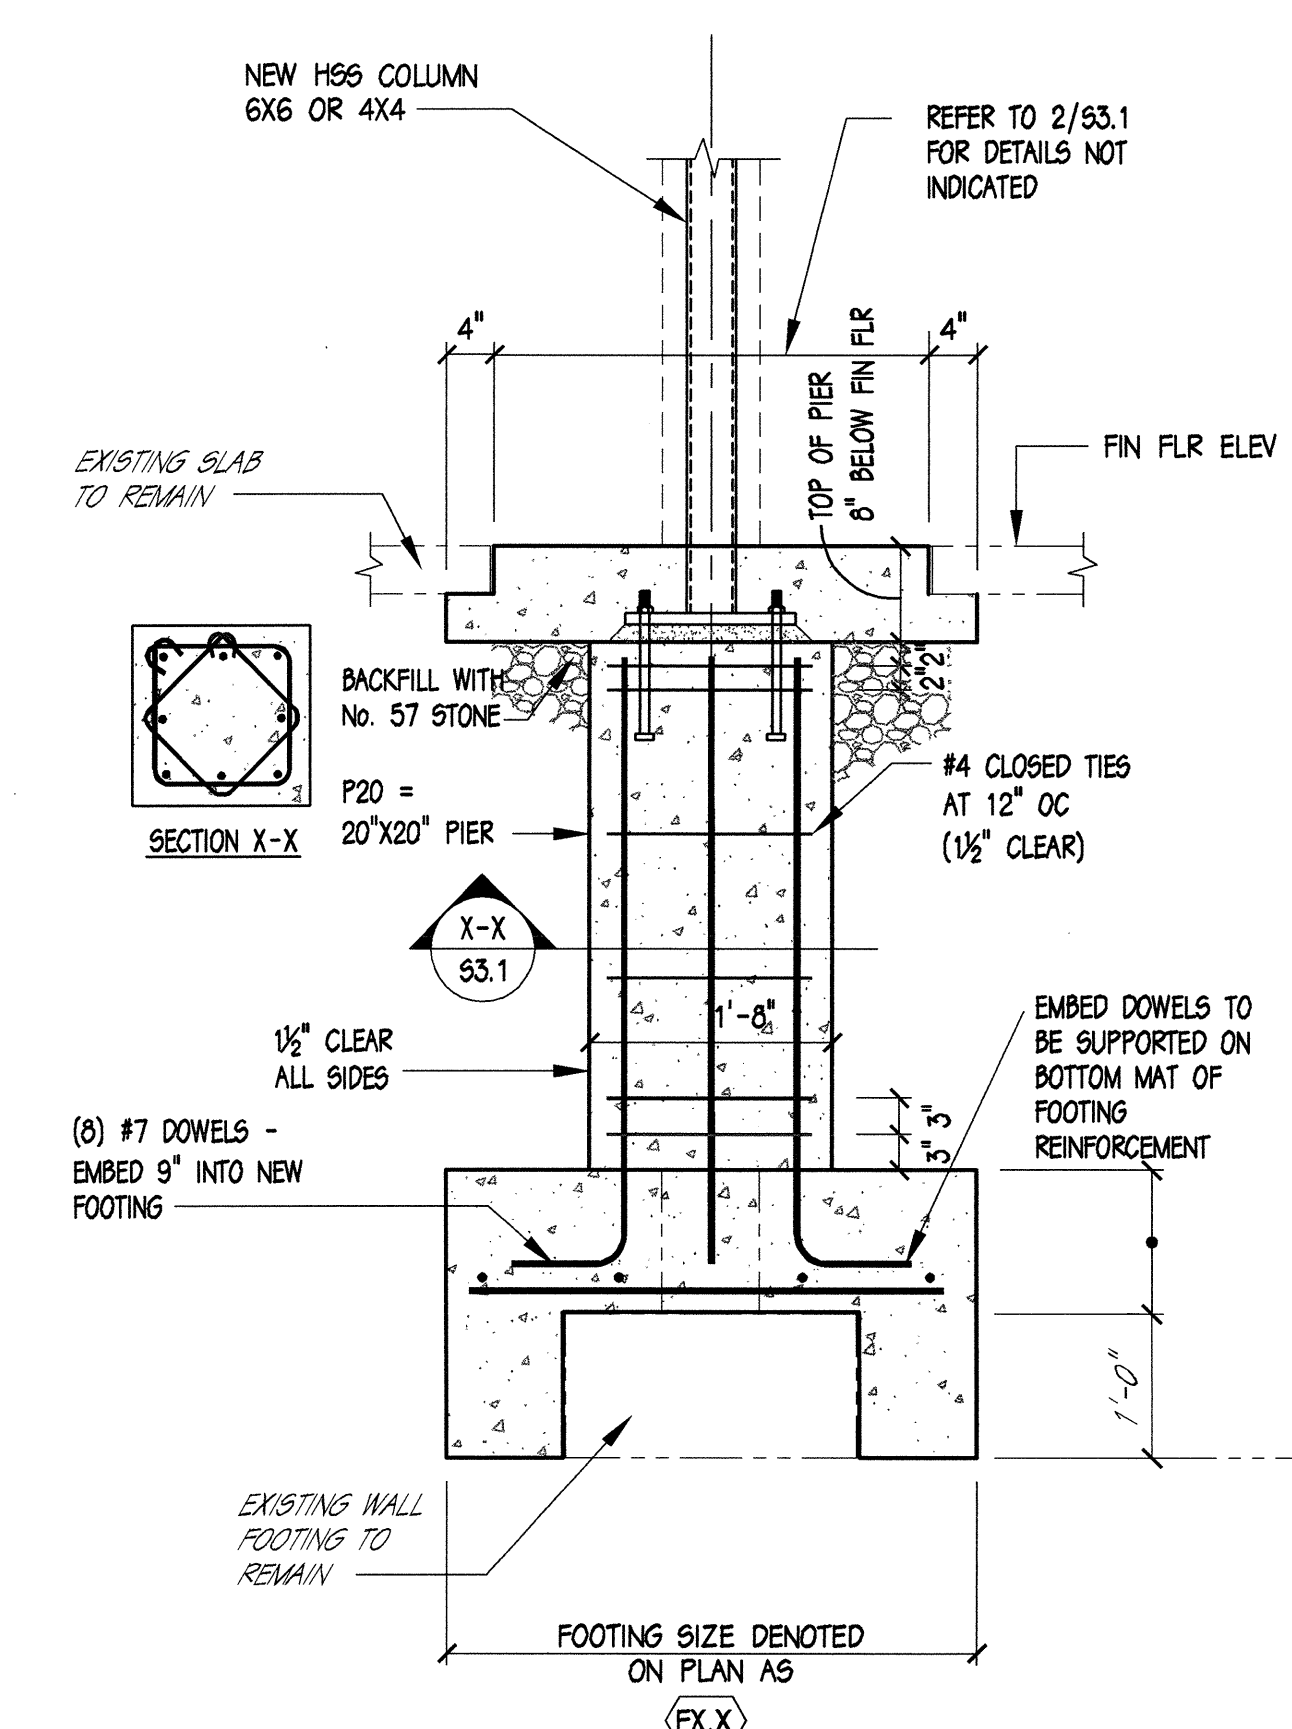

TYPICAL AT ALL NEW COLUMN FOOTING WHERE PIER IS INDICATED

SECTION 5
3/4" = 1'-0"

DUNBAR MULBY WILLIAMS
PITTMAN & VAUGHAN, PLLC
CONSULTING STRUCTURAL
ENGINEERS

120 PROPOSED PARK DRIVE, SUITE 201
RICHMOND, VIRGINIA 23059
PHONE (804) 273-9843 FAX (804) 273-9846
PROJECT# 0810-57

mbj ARCHITECTURE
A Professional Limited Company

GROVE PARK SQUARE
11537-B NUCKOLS ROAD
Richmond, Virginia 23059
☎ (804) 273-9811 fax: (804) 273-9843


mbj ARCHITECTURE

RAPPAHANNOCK
COMMUNITY COLLEGE
CAMPUS RENOVATIONS
WARSAW + GLENS, VIRGINIA
PC: 260-17712

TYPICAL FOUNDATION
SECTIONS
AND DETAILS

WORKING
DRAWINGS
NOT FOR
CONSTRUCTION

Date:	JANUARY 13, 2010
REVISIONS	
NO.	DATE

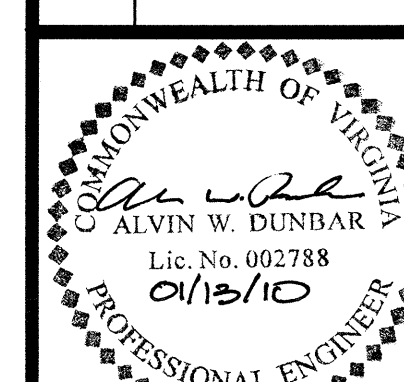

Sheet
S3.1
File Number